

Schrader Union - Schrader x Copper Tail (Including Cap and Core)

C&D Item No.	Size	Pressure Rating	Pack qty
CD-208-0403	1/4 x 3/16	43.5bar	1
CD-208-0404	1/4 x 1/4 With Support Knurl	43.5bar	5
CD-208-0404-P	1/4 x 1/4 No Support Knurl	43.5bar	5
CD-208-0504	5/16 x 1/4 With Support Knurl	43.5bar	5




Schrader Access Brass Unions (Including Cap and Core)

C&D Item No.	Size	Pressure Rating	Pack qty
CD-209-0403-3	1/4 SCHR x 3 Steps 3/16 ID x 1/4 & 3/8 OD	43.5bar	5
CD-209-0404	1/4 SCHR x 1/4 ID (3/8 OD SPIGOT)	43.5bar	5
CD-209-0504	5/16 SCHR x 1/4 ID	43.5bar	5



High Pressure Schrader Access Brass Unions (Including Cap and Core)

C&D Item No.	Size	Pressure Rating	Pack qty
CD-209-0403-3-HP	1/3 SCHR x 3 Steps 3/16 ID x 1/3 & 3/8 OD	130bar	5
CD-209-0404-HP	1/4 SCHR x 1/4 ID	130bar	5
CD-209-0406-HP	1/4 SCHR x 3/8 ID	130bar	5

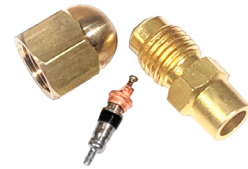

Flare Solder Adaptor - Female Flare x ID Solder

C&D Item No.	Size	Pressure Rating	Pack qty
CD-210-0404	1/4 x 1/4	43.5bar	1
CD-210-0504	5/16 x 1/4	43.5bar	1
CD-210-0606	3/8 x 3/8	43.5bar	1
CD-210-0808	1/2 x 1/2	43.5bar	1
CD-210-1010	5/8 x 5/8	43.5bar	1
CD-210-1212	3/4 x 3/4	43.5bar	1
CD-210-0606-XHP	3/8 x 3/8	130bar	1

KEY FEATURES

- The ultimate in single or multi-use flare connection security, these assemblies solder onto the copper tube. A specifically designed sacrificial washer is sandwiched in the joint between the Flare Safe's stainless steel seat and the flare surface, giving a secure moulded metal seal.



Metric - Flare Solder Adaptor - Female Flare x ID Solder

C&D Item No.	Size	Pressure Rating	Pack qty
CD-210-04-6M	1/4 x 6mm	43.5bar	1
CD-210-06-10M	3/8 x 10mm	43.5bar	1
CD-210-08-12M	1/2 x 12mm	43.5bar	1
CD-210-10-16M	5/8 x 16mm	43.5bar	1
CD-210-12-18M	3/4 x 18mm	43.5bar	1

Note: A new washer should be used each time the joint is opened. Part no: 111-series